

An In Vivo Evaluation of Bond Failure Rates with Hydrophilic and Self-Etching Primer Systems

JULIO PEDRA E CAL-NETO, DDS, MSC
JOSÉ AUGUSTO MENDES MIGUEL, DDS, MSC, PHD

Because moisture contamination is reportedly the most common reason for bond failure,¹⁻³ several manufactures have introduced hydrophilic systems for bonding to wet enamel surfaces. Transbond* Moisture Insensitive Primer (MIP), which contains a hydrophilic primer solution dissolved in ethanol, is recommended for use on either dry or wet etched enamel. This material is chemically identical to a widely used dentin-bonding agent⁴ (Adper Single Bond**).

Transbond Plus* Self-Etching Primer (SEP), which is mainly a solution of a methacrylated phosphoric acid ester, was developed to combine the etching and priming stages and eliminating the need for rinsing. This not only saves time and improves patient comfort, but also allows better moisture control.⁵

The purpose of the present study was to in-

*Trademark of 3M Unitek, 2724 S. Peck Road, Monrovia, CA 91016.

**Trademark of 3M ESPE, St. Paul, MN.

***American Orthodontics, 1714 Cambridge Ave., Sheboygan, WI 53082.



Dr. Cal-Neto

Dr. Miguel

Dr. Cal-Neto is a postgraduate resident and Dr. Miguel is a Professor, Department of Orthodontics, State University of Rio de Janeiro, Brazil. Dr. Miguel is also in the private practice of orthodontics in Niterói, Rio de Janeiro. Contact Dr. Cal-Neto at Rua Luis Belart 190/206, Jardim Guanabara, Rio de Janeiro, RJ 21941-100, Brazil; e-mail: juliocalneto@yahoo.com.br.

vestigate the in vivo bond failure rates of brackets bonded with composite resin after the use of either a conventional etchant and Transbond MIP or Transbond Plus SEP alone.

Materials and Methods

Fifteen consecutive patients at the Department of Orthodontics, School of Dentistry, State University of Rio de Janeiro, Brazil, participated in the study. Patients were eligible for the study if they:

- Required two-arch fixed appliance therapy.
- Had no caries, fillings, or hypoplasia.
- Had no occlusal interferences (to eliminate the influence of trauma on the bond failure rate).
- Gave their consent to the trial.

Extraction patients were included if their extractions were balanced on both sides of the mouth. Sex, age, and racial differences were ignored.

All teeth, except for the molars, were bonded directly with metal standard edgewise brackets.*** The primers were allocated by the split-mouth method: The mouth of each patient was divided into quadrants, and a contralateral bonding pattern was randomly alternated from patient to patient to assure an equal distribution of enamel treatments between the right and left sides.

In the hydrophilic primer quadrants, the teeth were isolated and dried with oil-free air. A 37% phosphoric acid etchant was applied to the enamel surfaces for 15 seconds, then rinsed with water and dried until the enamel was frosty white. Transbond MIP was applied to the etched enamel, according to the manufacturer's instructions, followed by a gentle burst of air. The bracket bases were coated with Transbond XT adhesive paste, and the brackets were positioned on the teeth with gentle pressure. After excess

TABLE 1
BOND FAILURE RATES WITH
DIFFERENT ENAMEL TREATMENTS

	No. Brackets	No. Failures	Failure Rate
Hydrophilic primer	118	3	2.54%
Self-etching primer	118	6	5.08%

adhesive was removed, each bracket was cured for 10 seconds per side with a halogen lamp (Ortholux XT*).

In the self-etching primer quadrants, the teeth were isolated and dried with oil-free air. Following the manufacturer's instructions, the material was rubbed vigorously onto each enamel surface for three seconds and gently air-dried for one second. The brackets were positioned and light-cured as described for the first group.

Initial archwires were fitted 15 minutes after bonding. All patients received the same instructions and were treated by Dr. Cal-Neto using a similar preadjusted edgewise technique. Patients were seen at three-to-four-week intervals, but were asked to come in as soon as possible if a bond failure became apparent. The sites and dates of any bond failures during the first six months of treatment were recorded.

Results

Only nine bond failures were noted during the six-month observation period: three (2.54%) with conventional acid etching and the hydrophilic primer, and six (5.08%) with the self-etching primer (Table 1). The corresponding bracket survival curves were plotted using a Kaplan-Meier product-limit estimate (Fig. 1). There was no significant difference ($p < .05$) in bond failures between the two groups (hazard ratio = .49; 95% confidence interval = .13-1.85; log rank test, $p = .299$).

Discussion

In another in vivo study under similar conditions, the bond failure rate of Transbond Plus SEP was 10.99%.⁵ Although bond failure rates below 10% are generally considered to be clinically

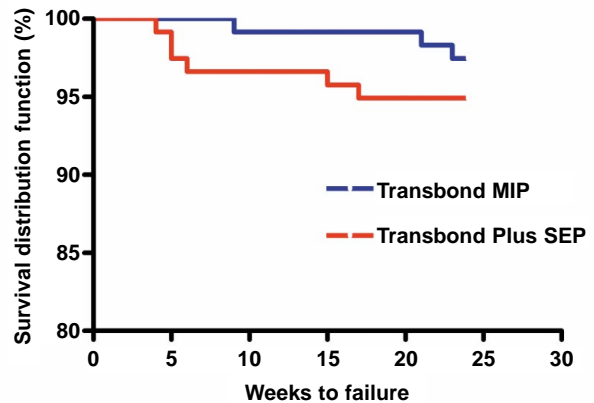


Fig. 1 Graph of Kaplan-Meier survival plots for brackets bonded with different enamel treatments.

acceptable, a direct comparison may not be entirely valid because there is no standardized protocol for clinical studies.⁶ The Transbond MIP demonstrated a lower bond failure rate in our study, but the difference was not statistically significant.

We limited our data collection to a six-month period because most bond failures occur within the first six months after bracket placement.⁷ A 12-to-18-month study might have found more failures for the self-etching primer, which tends to weaken over time. Still, this clinical trial demonstrates that a self-etching primer can be a viable alternative to conventional adhesives. It can save chairtime and reduce the potential for placement errors and moisture contamination without significantly affecting the bond failure rate.

REFERENCES

1. Bishara, S.E.; Khowassah, M.A.; and Oesterle, L.J.: Effect of humidity and temperature changes on orthodontic direct-bonding adhesive systems, *J. Dent. Res.* 54:751-758, 1975.
2. Zachrisson, B.U.: A posttreatment evaluation of direct bonding in orthodontics, *Am. J. Orthod.* 71:173-189, 1977.
3. Gwinnett, A.J.: Bonding of restorative resins to enamel, *Int. Dent. J.* 38:91-96, 1988.
4. Grandhi, R.K.; Combe, E.C.; and Speidel, T.M.: Shear bond strength of stainless steel orthodontic brackets with a moisture-insensitive primer, *Am. J. Orthod.* 119:251-255, 2001.
5. Ireland, A.J.; Knight, H.; and Sherriff, M.: An in vivo investigation into bond failure rates with a new self-etching primer system, *Am. J. Orthod.* 124:323-326, 2003.
6. Brantley, W.A. and Eliades, T.: *Orthodontic Materials: Scientific and Clinical Aspects*, Thieme, Stuttgart, Germany, 2001.
7. Hegarty, D.J. and MacFarlane, T.V.: In vivo bracket retention comparison of a resin-modified glass ionomer cement and a resin-based bracket adhesive system after a year, *Am. J. Orthod.* 121:496-501, 2002.